


FASCO Motor Scope Selection Guide

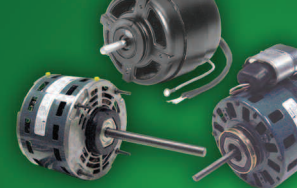

SHADED POLE MOTORS - 4.4" & 5.0" DIAMETER

FASCO MODEL#	DIA.	HP	VOLTS	RPM	SPD.	AMPS	ENCLOSURE	ROT.	BRNG.	SHAFT DIM.
D635	4.4	1/10-1/20-1/35	230	1550	3	1.8-1.3-1	Open Vent.	DS	SLV	10 X 1/2 X 10
D174	4.4	1/10	115	1500	1	3.5	Open Vent.	CW	SLV	3/8 X 2-7/8
D1039	4.4	1/10	115	1500	1	3.1	Open Vent.	CCW	SLV	1/2 X 2-3/8
D112	4.4	1/10	115	1500	1	3.6	Open Vent.	CW	SLV	3/8 X 2-5/8
D480	4.4	1/10	115 / 208-230	1550	1	4.5-2.2	Open Vent.	CW	SLV	3/8 X 3-1/8
D481	4.4	1/10	115 / 208-230	1550	1	4.5-2.2	Open Vent.	CCW	SLV	3/8 X 3-1/8
D435	4.4	1/10	230	1500	1	1.7	Open Vent.	CCW	SLV	3/8 X 2-5/8
D337	4.4	1/8-1/10-1/12-1/15	115	1550	4	4.1-2.7-2.3-1.9	Open Vent.	DS	SLV	7-1/2 X 1/2 X 7-1/2
D339	4.4	1/8-1/12	230	1550	2	2-1.4	Open Vent.	DS	SLV	6-1/2 X 1/2 X 6-1/2
D374	4.4	1/8-1/20	115	1500	2	4-2.5	Open Vent.	CW	SLV	3/8 X 2-1/2
D338	4.4	1/6-1/10-1/12-1/15	115	1550	4	5.4-3.2-2.5-2.1	Open Vent.	DS	SLV	7-1/4 X 1/2 X 7-1/4
D1006	4.4	1/4	115	1600	1	7.2	Open Vent.	CW	SLV	1/2 X 2-3/4
D249	5	1/50-1/80-1/160	115	1050	3	1.1-6-.4	Open Vent.	DS	SLV	7-5/8 X 3/8 X 7-5/8
D340	5	1/40	115	1050	1	1.1	Tot. Encl.	CW	SLV	3/8 X 2-5/8
D143	5	1/30-1/40	115	1050	2	1.5-1	Open Vent.	CCW	SLV	1/2 X 1-5/8
D655	5	1/25-1/40-1/70	230	1050	3	.7-.5-.3	Open Vent.	DS	SLV	10 X 1/2 X 10
D255	5	1/25-1/50-1/80	115	1050	3	1.5-1-.6	Open Vent.	DS	SLV	7-1/2 X 1/2 X 7-1/2
D250	5	1/25-1/50-1/80	115	1050	3	1.5-1-.6	Open Vent.	DS	SLV	8 X 3/8 X 8
D1038	5	1/25	115	1050	1	1.4	Open Vent.	CW	SLV	1/2 X 2-1/2
D253	5	1/20-1/40-1/50	115	1050	3	2.2-1.4-.8	Open Vent.	DS	SLV	7-1/2 X 1/2 X 7-1/2
D252	5	1/20-1/40-1/70	115	1050	3	1.6-.8-.5	Open Vent.	DS	SLV	7-1/2 X 3/8 X 7-1/2
D1036	5	1/20	115	1045	1	1.95	Open Vent.	CW	SLV	3/8 X 2-1/8
D242	5	1/20	115	1050	1	2	Open Vent.	CW	SLV	3/8 X 3
D494	5	1/20	115 / 208-230	1050	1	3-1.6	Open Vent.	CW	SLV	3/8 X 3-1/8
D495	5	1/20	115 / 208-230	1050	1	3-1.6	Open Vent.	CCW	SLV	3/8 X 3-1/8
D257	5	1/15-1/20-1/25	277	1050	3	1.1-.7-.6	Open Vent.	DS	SLV	9 X 1/2 X 9
D389	5	1/15-1/20-1/30-1/50	115	1050	4	2.4-1.6-1.1-.8	Open Vent.	DS	SLV	10-1/4 X 1/2 X 10-1/4
D142	5	1/15-1/25	115	1050	2	2.6-1.6	Open Vent.	CW	SLV	3/8 X 2-3/8
D254	5	1/15-1/30-1/50	115	1050	3	2.1-1.3-.8	Open Vent.	DS	SLV	8 X 3/8 X 8
D251	5	1/15-1/35-1/50	208-230	1050	3	1.2-.5-.4	Open Vent.	DS	SLV	9-1/4 X 1/2 X 8-1/2
D342	5	1/15	115	1050	1	2.3	Open Vent.	CW	SLV	3/8 X 2-1/2
D140	5	1/15	115	1050	1	2.7	Open Vent.	CW	SLV	3/8 X 2-3/8
D492	5	1/15	115 / 208-230	1050	1	3.4-1.7	Open Vent.	CW	SLV	3/8 X 3-1/8
D493	5	1/15	115 / 208-230	1050	1	3.4-1.7	Open Vent.	CCW	SLV	3/8 X 3-1/8
D1054	5	1/12-1/20-1/25	115	1050	3	3.1-2.1-1.5	Open Vent.	CW	SLV	1/2 X 2-1/2
D160	5	1/10-1/12-1/15	115	1050	3	3.4-2.8-2.4	Open Vent.	CW	SLV	3/8 X 3-7/8
D256	5	1/10-1/20-1/30	115	1050	3	3.4-1.7-1	Open Vent.	DS	SLV	8 X 1/2 X 8
D176	5	1/10-1/20	115	1050	2	3.9-1.7	Open Vent.	CW	SLV	3/8 X 3
D293	5	1/10-1/30-1/40-1/45-1/50	115	1050	5	3.6-1.6-1.2-.8-.6	Open Vent.	DS	SLV	10-3/4 X 3/8 X 10-3/4
D289	5	1/10-1/30-1/40-1/45-1/50	115	1050	5	3.6-1.6-1.2-.8-.6	Open Vent.	DS	SLV	10-3/4 X 1/2 X 10-3/4
D154	5	1/10	115	1050	1	5	Open Vent.	CW	SLV	3/8 X 2-3/4
D148	5	1/10	115	1050	1	3.6	Open Vent.	CW	SLV	3/8 X 3-1/2
D144	5	1/10	115	1050	1	3.6	Open Vent.	CW	SLV	1/2 X 4-1/2
D490	5	1/10	115 / 208-230	1050	1	5-2.5	Open Vent.	CW	SLV	3/8 X 3-1/8
D491	5	1/10	115 / 208-230	1050	1	5-2.5	Open Vent.	CCW	SLV	3/8 X 3-1/8
D356	5	1/8-1/10-1/12	115	1050	3	4.7-3.7-3.2	Open Vent.	CW	SLV	1/2 X 3-1/2
D316	5	1/8-1/10	230	1050	2	2.1-1.8	Open Vent.	CW	SLV	1/2 X 3-1/2
D178	5	1/8-1/11	115	1050	2	4.5-3.4	Open Vent.	CW	SLV	1/2 X 4
D180	5	1/8-1/11	115	1050	2	4.5-3.4	Open Vent.	CW	SLV	1/2 X 4
D314	5	1/8-1/15	230	1050	2	2.3-1.5	Open Vent.	CW	SLV	1/2 X 5
D1046	5	1/8	115	1070	1	5.1	Open Vent.	CW	SLV	1/2 X 2-1/4