

Valve

VB-9313 Series 2-1/2" thru 3" Screwed End, 2-1/2" thru 6" Flanged End Mixing Valves


For Use With: VA-9313; VC-9313; VK-9313; VM-9313; VP-9313; VS-9313, VU-9313

Valve Body Part No.	Size & Port	Packing	Bracket Nut	Valve Repair Kit Includes Packing Stem & Plug Assm. Bottom Gasket	Current Bonnet Assembly* Includes Packing & Bracket Nut	Bottom Gasket	Seat Ring**
	Item No.	1	2	3	4	5	6
VB-9313-0-4-12	2-1/2" Port 12	YBA-651-1	OYBB-225	RYB-931-12	YBA-652	BYRZ-13-12	RYB-9213-101-0-12
VB-9313-0-4-13	3" Port 13	YBA-651-1	OYBB-225	RYB-931-13	YBA-652	BYRZ-13-13	RYB-9213-101-0-13
VB-9313-0-5-12	2-1/2" Port 12	YBA-651-1	OYBB-225	RYB-931-12	YBA-652	BYRZ-13-12	RYB-9213-101-0-12
VB-9313-0-5-13	3" Port 13	YBA-651-1	OYBB-225	RYB-931-13	YBA-652	BYRZ-13-13	RYB-9213-101-0-13
VB-9313-0-5-14	4" Port 14	YBA-651-1	OYBB-225	RYB-931-14	YBA-652	BYRZ-13-14	RYB-9213-101-0-14
VB-9313-0-5-15	5" Port 15	YBA-651-1	OYBB-225	RYB-931-15	YBA-652	BYRZ-13-15	RYB-9213-101-0-15
VB-9313-0-5-16	6" Port 16	YBA-651-1	OYBB-225	RYB-931-16	YBA-652	BYRZ-13-16	RYB-9213-101-0-16

*Direct replacement for old style.


**Replacement for top or bottom seat.

Old Style*




(4 Req'd) 1,3

Current Bonnet Assembly

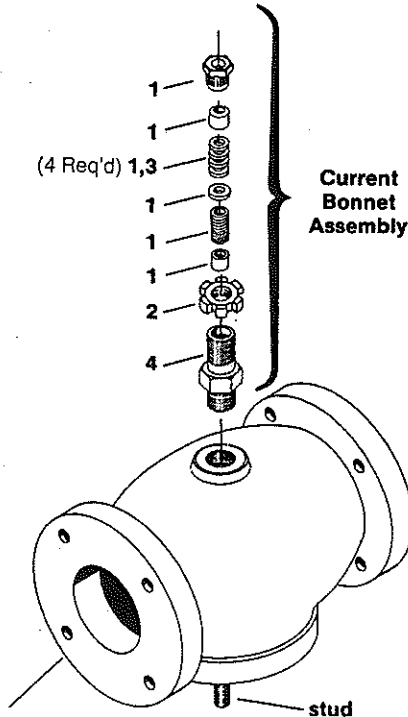

*Replace with current bonnet assembly (YBA-652) if any of the old style packing components — no longer available — require replacement. The old style bonnet assembly can easily be identified by noting the large hex head packing gland nut with internal threads.

Note: VB-9313-0-4-12 and VB-9313-0-4-13 bodies are screwed end.

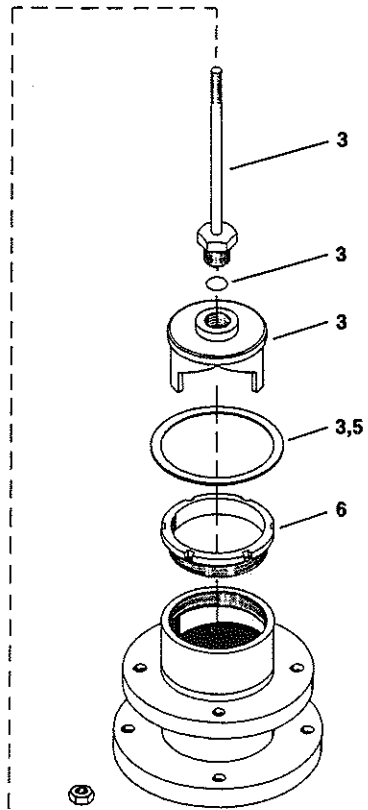

VB-9313

MAINTENANCE PARTS